9334Z 28 DEC 65	5	ECRET	B00500R00010006002Q	112
DIRECTOR 25X1A	25X1A	OUTING	6 DTENT	125
Chief Ops Plans Sec. File TOR: 2028Z 25 F6	Aul 2	01.13		IN 79443 25>
THE THE THE	W.C.	The second of th	And the same control at the same control and the s	6299

FOLLOWING IS A SUMMARY OF PILOT'S STATEMENT:

25X1A

TAKEOFF SCHEDULED FOR 1300L ON 28 DECEMBER 1965. FULL GROSS WEIGHT. FLY LONG LINK ROUTE AND CHECK REACON, ARC-50, SSR SEL-CALL FEATURE THIS AIRPLANE JUST COMPLETED "GOODIE" MODS AND PILOT QUESTIONED GROUND CREW EXTENSIVELY ON WORK ACCOMPLISHED. PILOT DECIDED TO CLIMB AT 400 KEAS INSTEAD OF 440 IN VIEW OF INLET WORK ETC, SINCE LAST FLIGHT TOD COMPUTED FOR 7500'. ENGINE START CART FOR LEFT ENGINE QUIT DUR-ING START SO STARTED RIGHT ENGINE FIRST AND THEN LEFT. REST OF THE PREFLIGHT WENT NORMAL. TAXI OUT NORMAL. LEFT ENGINE STALLED DURING RUN UP AS PILOT HAD BEEN BRIEFED IT MIGHT - HE DOWN TRIMMED AND RUN UP NORMAL. SAS ON - ALL OK, NO LITES. ALL LIGHTS ON TELE TALE PANEL NORMAL. PILOT STARTED TAPE AT START ROLL AND RECORDED 65,000 LBS AT 190 KTS PILOT LIFTED NOSE OFF RUNWAY - ALL NORMAL. MAIN WHEELS LEFT GROUND THE ACFT IMMEDIATELY BECAME VERY UNSTABLE IN PILOT DESCRIBED FEELING AS SIMILAR TO THE TRAINER WHEN ALL ALL AXIS. SAS OFF, NO FUEL IN NRR 1 TANK AND RUDDER KICKED HARD. PILOT

Approved For Release 2002/05/31: CIA-RDP71B00590R 00010 OF THE PROPERTY OF THE

Approved For Release 2002/05/31: CIA-RDP71B00590R000100060020-8

25X1A											
	6299	IN	79443	S	E	C	R	F.	T	PAGE	TWO

EMMEDIATELY CHECKED SAS - NO LITES ON - HE WAS USING FULL CONTROL

DEFLECTIONS TO OVERCOME AIRCRAFT EXCURSIONS. AS SPEED INCREASED

EXCURSIONS BECAME MORE VIOLENT AND PILOT SAID NOSE OF AIRCRAFT WAS

GYRATING WILDLY. NOSE SUDDENLY TOOK ABOUT 15 DEG DOWN PITCH AND

STARTED ROLLING TO LEFT. PILOT APPLIED FULL AFT AND FULL RIGHT STICK

AND RUDDER WITHOUT APPARENT EFFECT. PILOT STATED GROUND APPEARED TO

BE IMMEDIATELY BELOW THE AIRCRAFT AND HE REALIZED HE WAS NOT ABLE

TO CONTROL GYRATIONS AND ELECTED TO EJECT. HE PULLED D RING, SAW

CANOPY GO, FELT ROCKET IGNITE. SAW FLAME IN COCKPIT FROM ROCKET

MOTOR, SEPARATED FROM SEAT IMMEDIATELY BEFORE IMPACT WITH GROUND. HE

THOUGHT HE WAS GOING TO HIT SEAT. HE IMPACTED WITH GROUND VERY HARD

AND FELT SHARP PAIN IN HIS RIGHT LEG AND THOUGHT HE'D BROKEN IT.

RELATED COMMENTS:

25X1A 25X1A

25X1A 25X1A

25X1A

PRELIMINARY TALKS WITH CHASE PILOT,

OFFICER,

TEND TO CONFIRM

STATEMENT

THAT ALL WAS NORMAL UNTIL LIFT OFF. PILOT APPEARS TO HAVE NO BROKEN

BONES AND ONLY MINOR BRUISES. BEAUTIFUL EJECTION SYSTEM PROVEN ONCE

AGAIN PLUS HIGH DEGREE OF TRAINING AND FAST REFLEXES OF PILOT COM
BINED TO SAVE A LIFE AND GIVE US A MAN TO TALK TO IN DETERMINING

WHAT HAPPENED. I VE GROUNDED ALL

FURTHER NOTICE. NEXT CONSTRUCTIVE INFORMATION WILL PROPARLY COME

FROM NORTON TEAM. WITNESS REPORTS HAVE ACFT CONTACTING THE GROUND

NOSE DOWN, LEFT WING DOWN AND ROLLING LEFT.

END OF MSG